

# Manhole Inspection Summary

Manhole # S29K\_\_012MH

Printed On: 1/29/2009

Page 1 of 6

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **29K** Node: **012** Status: **Found**

Insp Date: **11/24/08 9:00 AM**

Incomplete Comments

Crew: **skwj**  
Inspector: **wjenkins**  
Firm: **PER**

**Location** Address: **303 S. Fremont Ave**

Cross Street: **Portland St**

**Manhole** Type: **Junction** Location: **Grass**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments **Heavy debris in channels...see pics**

**Cover** Shape: **Circular** Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **5** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **4** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Partially Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Steps** Count: **9** Missing: **0** ☒ **Corroded**

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **5** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S29K\_\_012MH

Printed On: 1/29/2009

Page 2 of 6

Location View



Top View



misc-5



A/B grade 11"

misc-3



Frame View

misc-4



mh cover view

Defect 9



barrel infiltration, evidence of surcharge

Defect 8



heavy debris and sediment on bench

Defect 7



cracked mortar at outside of chimney

Defect 6



infiltration from the frame

Defect 5



root infiltration at the joint signs of infiltration at wall

Defect 4



3.5" gap at the joint w/signs of infiltration

Defect 3



loose bricks and deterioration under frame

Defect 2



frame offset 5"

Defect 1



corroded rungs



## Manhole Inspection Summary

Manhole # S29K\_\_012MH

Printed On: 1/29/2009

Page 5 of 6

10 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **15.89** (ft.) Flow Characteristics: **Fast**  
Deposits: ☐ None ☐ Mud ☒ **Sludge** ☒ **Debris** ☐ Grease  
Silt Depth: **3** (in.) Deposits Extent: **Medium**  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow



heavy debris in channel

Pipe Height: **4.8** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **15.70** (ft.) Flow Characteristics: **Slow**  
Deposits: ☐ None ☐ Mud ☒ **Sludge** ☒ **Debris** ☐ Grease  
Silt Depth: **3** (in.) Deposits Extent: **Heavy**  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S29K\_\_012MH

Printed On: 1/29/2009

Page 6 of 6

8 in. Circular Gravity Sewer

5 O'Clock Inflow

Pipe In @ 5 O'Clock

Drop In @ 5 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.40** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☒ **Debris** ☐ Grease

Silt Depth: **3** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Inside** Rod and Bar  
Angled: **Yes** Reading: **14.67** (ft.)  
Inv Depth: **15.67** (ft.)  
Drop Condition: **Open**


Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock

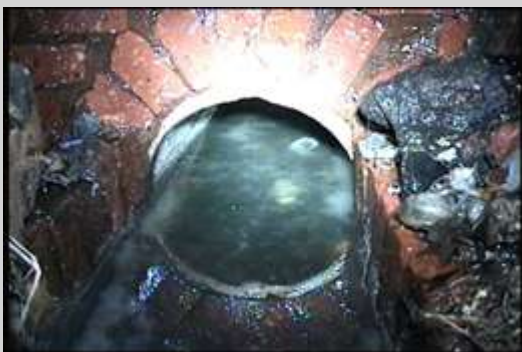

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **15.76** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☒ **Debris** ☐ Grease

Silt Depth: **3** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection